

[2008 Saturn Astra](#) | [Astra \(VIN A\) Service Manual](#) | [HVAC](#) | [View All Bulletins](#) | Document ID: 2133609

#08-01-39-004: Rattle Noise From Right Front Area of Engine Compartment (Reposition A/C Line Away From Frame Rail) - (May 9, 2008)

Subject: Rattle Noise From Right Front Area Of Engine Compartment (Reposition A/C Line Away From Frame Rail)

Models: 2008 Saturn Astra




Condition

Some customers may comment on a rattle noise from the right front area of the engine compartment. Technicians may find the noise easier to hear inside the vehicle rather than outside the vehicle.

Cause

The low side Air Conditioning (A/C) line may contact the right front frame rail just below the air cleaner assembly.

Correction

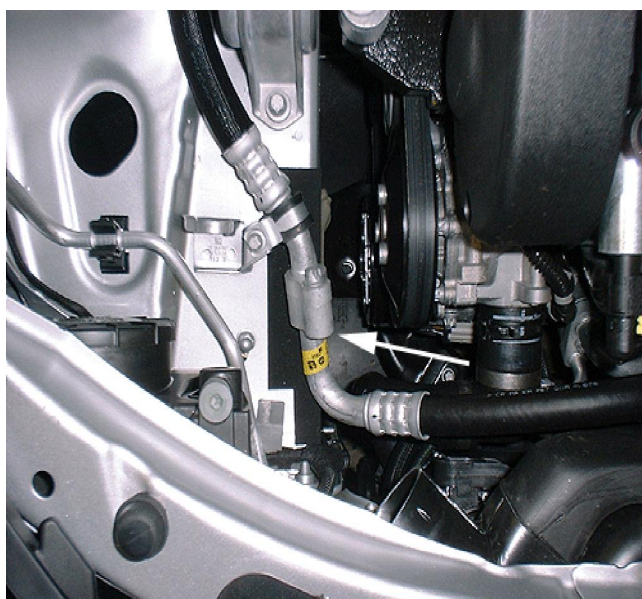

Technicians are to reposition the A/C line to provide sufficient clearance away from the frame rail.
© 2019 General Motors Corporation. All rights reserved.

Refer to the illustration above, which shows the location of the A/C line contact point on the frame rail.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
D9738*	Reposition A/C Line	0.2 hr
*This labor operation number is for bulletin use only. This number will not be published in the Labor Time Guide.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT
VOLUNTARY
TECHNICIAN
CERTIFICATION